


Ideal Inspection
 (a division of Ideal Oilfield Construction Ltd.)
 P.O Box 1473
 Brooks, Alberta
 T1R 1C3
 Phone: 403-362-2843 Fax: 403-362-2862


INSPECTION REPORT

Client: Four Star Ventures Location: DaPaJo Construction Limited Date: April 05, 2012
 P.O. : Work Order : 2139m Report : 3483
 Page : 1 of 1 Rig or Unit : #5 B Inspection: Magnetic Particle
 Parts Examined: 7" Web Wilson 50 Ton elevator S/N: L2470
 Surface Condition: Painted Material Temperature: 20° Celsius
 Procedure: MPI-DPJ-001 Code: ASME Section V, ASTM E709
 Equipment: Parker B 310 Contour Probe, PM-50 Permanent Magnets
 Method: Magnetic Particle, AC Continuous, Wet Colour Contrast Method
 Test Medium: Magnaflux 7HF prepared bath

Test Results: No defects found at time of inspection.
 Engineer's Approval:

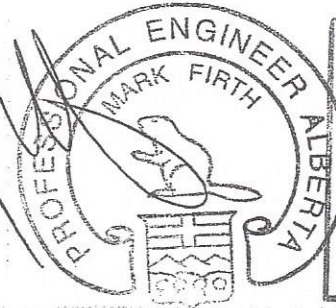

PERMIT TO PRACTICE
FIRTH ENGINEERING LTD.
 Signature _____
 Date _____
PERMIT NUMBER: P 6554
 The Association of Professional Engineers,
 Geologists and Geophysicists of Alberta

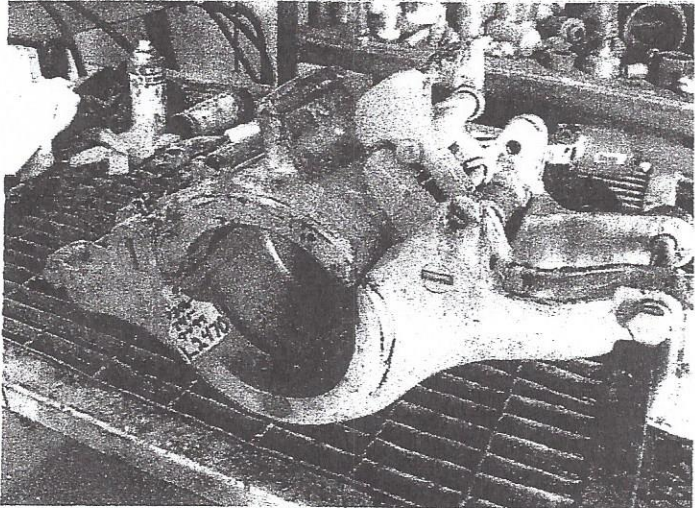

Photos:

Technician:	John Frances	CGSB #:	7062	Signature:		Assistant:	Tyler Nevison
Repairs Complete	Yes	No	N/A	X		Acceptable For Service	Yes X No